


Information

NetComm Product Name	NB9WMAXXn
NetComm Product Description	ADSL VoIP Wireless Router
Firmware Version	C01_R12
Official / Beta Firmware	Official Release
File Name	NB9WMAXXn-D111-S310NCM-C01_R12_20110322.bin
File Size	3.70 MB
Date	30 th of March 2011

Upgrade Instruction

1. Connect the LAN port of the NB9WMAXXn to your PC with an Ethernet Cable.
2. Open a web browser, (such as Microsoft Internet Explorer). Go to <http://192.168.1.1/> to access the NB9WMAXXn management console.
3. On the left-hand side menu, click on **Management > Device Settings > Update Firmware**.

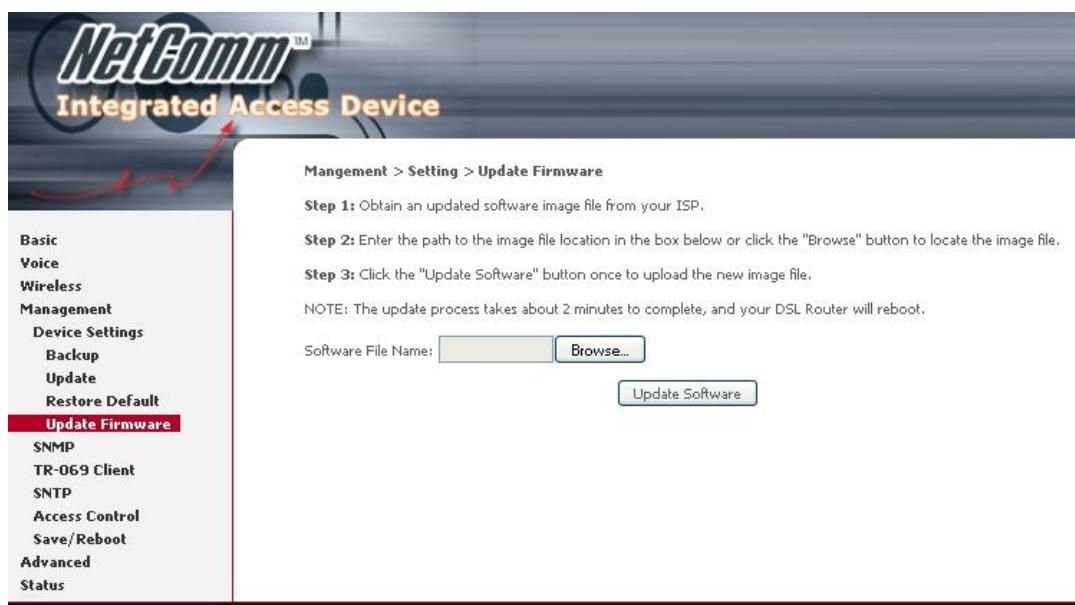

4. On the right-hand side, click on the **Browse** button to search your local hard drive and locate the firmware to be used for update. Select the firmware file and press **Open**.
5. Click **Update Software** to proceed.

6. Wait for 2 minutes for the device to upgrade and reboot itself.
7. Go to **Management > Restore Default**, click “Restore Default Settings” button then click ok in the pop up window to implement restore default settings on NB9WMAXXn.
8. The NB9WMAXXn will reboot itself again. Please wait for at least 2 minutes.
9. Firmware upgrade is done.

New Features

C01_R12

- N/A

Bug Fixes

C01_R12

- Fixed the default gateway issue that is forced to dynamic while one PVC is PPPoE or PPPoA

Known Issue

- N/A

Version History

C01_R11

- New Features
 - N/A
- Bug Fixes
 - Fixed “Incoming PSTN Call Results in Engaged Tone” issue
 - Fixed “Unable to make calls to 13/1300 numbers using iiNet” issue
- Known Issue
 - N/A

C01_R10

- New Features
 - N/A
- Bug Fixes

- Fixed device crash when using “ADSL Quick Setup” page for PPPoE connection
- Known Issue
 - N/A

C01_R08

- New Features
 - N/A
- Bug Fixes
 - Fixed IGMP join/ leave packets issue
- Known Issue
 - N/A

C01_R10

- New Features
 - N/A
- Bug Fixes
 - Fixed the Remote Web Interface login security issue
 - Fixed SIP Registration issue for TPG and iiNet
- Known Issue
 - N/A